

Friday, 2/23/2007 1:47:37 PM
User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FWD TUBE ASSEMBLY
Job Number	: 30925		
Estimate Number	: 10467		
P.O. Number	: N/A	Part Number	: D3391021
This Issue	: 2/23/2007	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D3391 UNDER REVIEW <i>AA 07.02.26</i>
First Issue	: N/A	Project Number	: N/A
Previous Run	: 30924	Drawing Revision	: <i>EF</i>
	Type : MACHINED PARTS	Material	: <i>N/A</i>
Written By	:	Due Date	: 3/21/2007
Checked & Approved By	: <i>AA 07.02.26</i>	Qty:	1 Um: Each
Comment	: Est. A 05.09.13 New issue KJJ/JLM		
	: Est. B 06.02.10 Dwg rev.D ecn 773 EC		
	: Est. C 06.05.02 Added inspections EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description:
---------	-----------------------	--------------

1.0	D6013047	SKIDTUBE MAT'L
-----	----------	----------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

SKIDTUBE MAT'L

Pick:

Qty	Part Number	Description	Batch
1	D6013-047	Extrusion	<i>B 26547</i>

JD 7-3-22

2.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

Cut extrusion to 46.52 +0.010 -0.020

JD 7-3-8

3.0	BENDING	BENDING MACHINE
-----	---------	-----------------



Comment: No bender

Bend as per Dwg D3391 Using Bend Prog 3391021

EL 7-3-28

4.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

DP 7-3-29

5.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------



Comment: HAAS CNC VERTICAL MACHINING #1

1-Machine as per Folio FA590 Rev. *AA* & Dwg D3391 Rev. *E*

Identify as D3391-1

2-Deburr

BC 07.04.02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 2/23/2007 1:47:37 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 30925

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

SC 07-04-07

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

mk 07/04/02

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill and c/sink float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5-Drill wearplate holes as per Dwg D3391 Using Dt8217 & DT8878

6--Deburr

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07-04-20

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

M-L

07/04/23

11.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

07-04-23

12.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

LL

07-04-23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 2/23/2007 1:47:37 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 30925

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Feb

07/04/27 ①

14.0

NAS1330C3KB166

INSERT



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Rivnut

Pick:

Qty

Part Number

Description

Batch

14

NAS1330C3KB166

Insert

m103278

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

Feb

07/04/27 ①

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

2008-01 ①

17.0

D3401041

Tow Cap Assembly



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Tow Cap Assembly

Pick:

Qty

Part Number

Description

Batch

1

D3401-041

Tow Cap

B31346

18.0

AN3C4A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Pick:

Qty

Part Number

Description

Batch

PH 07-05-02 10

4

AN3C4A

Bolt

M103691

TURNOVER

19.0

NAS1515H3L

WASHER



①

Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Washer

Pick:

Qty

Part Number

Description

Batch

m-h 07/05/03

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
07.05.18	18.	ADD 03564-1 ^{woorplate} Wasket (1) <u>M31398</u> 03566-13 Wasket (1) <u>B31348</u> PERMANENT CHANGE	RH 07.05.18				

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 2/23/2007 1:47:38 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 30925

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description:

4

NAS1515H3L

Washer

M103641

20.0

AN960C10L

washer



10 PH 07.05.02



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
washer

M104215

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1
Install tow Cap as per Dwg D3391
Identify as D3391-021

M.A 07/05/03

22.0

QC5

INSPECT WORK TO CURRENT STEP



070511

Comment: INSPECT WORK TO CURRENT STEP
Inspect thread of each insert using DT8821

23.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
Identify and Stock
Location: _____

PRP B 30363

07/05/11 59

24.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

070511

Job Completion



07-05-11


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

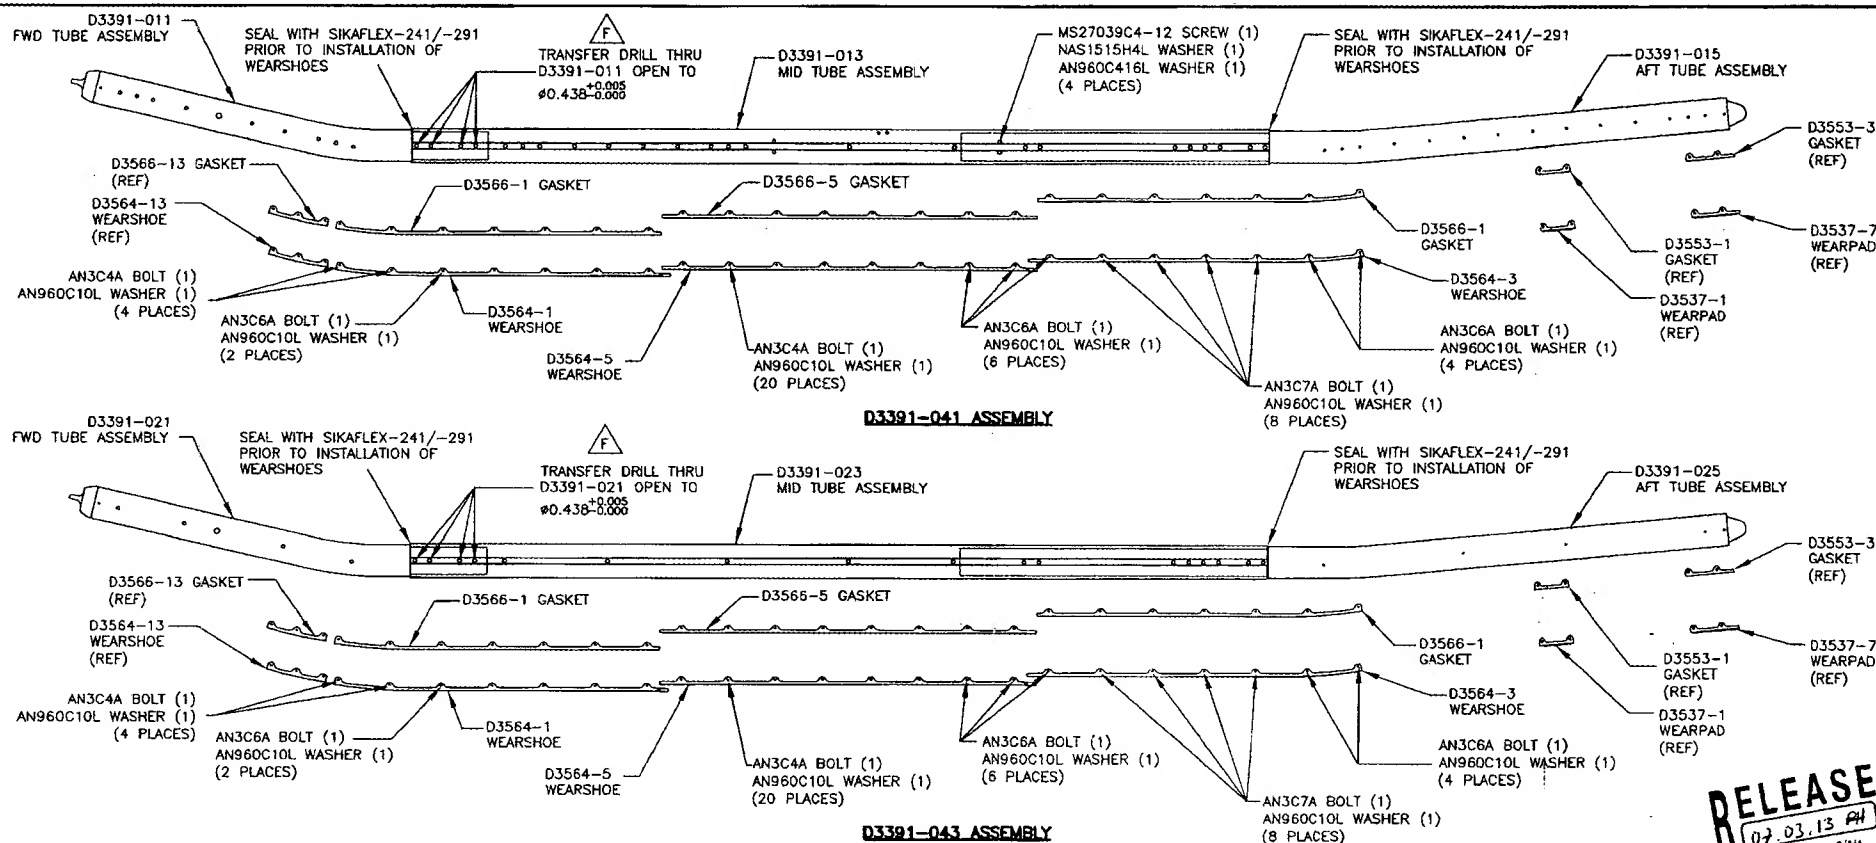

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	QTY	PART NUMBER	DESCRIPTION
041	043		
X	X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
		D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
1	1	D3391-021	FWD TUBE ASSEMBLY
1	1	D3391-023	MID TUBE ASSEMBLY
1	1	D3391-025	AFT TUBE ASSEMBLY
1	1	D3564-1	WEARSHOE
1	1	D3564-3	WEARSHOE
1	1	D3564-5	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
24	24	AN3C4A	BOLT
12	12	AN3C6A	BOLT
8	8	AN3C7A	BOLT
44	44	AN960C10L	WASHER
4	4	MS27039C4-12	SCREW
4	4	NAS1515H4L	WASHER
4	4	AN960C416L	WASHER

GENERAL NOTES

- 1) ALL DIMENSIONS ARE IN INCHES
- 2) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) FINISH: ACID ETCH AND ALODINE PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 4) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 'E' SIZE HOLES (Ø0.250-Ø0.257) FOR WEARSHOE INSERTS. C'SINK Ø0.391/Ø0.425 x 100' AS APPLICABLE AND INSTALL INSERTS EXCEPT WHERE INDICATED.

COPYRIGHT © 2008 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

F	07.01.18	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021
E	06.04.25	CHANGE TOLERANCE, EASE MANUFACTURE
D	06.01.23	UPDATE TOLERANCE, CHANGE HOLE SIZE
C	05.09.27	LENGTHEN AFT EXTENSION
B	05.06.10	DRAWING UPDATES
A	05.02.07	NEW ISSUE
DESIGN	PH	DRAWN BY PH
CHECKED	PH	APPROVED PH
DATE	07.01.18	TITLE 412 FLOAT SKIDTUBE
		REV. F SHEET 1 OF 5 SCALE NTS


DART DART AEROSPACE USA, INC.
PORT HADLOCK, WA

DRAWING NO. D3391


TITLE 412 FLOAT SKIDTUBE

RELEASED
07.03.13 PH
per ECN #934


RELEASED
07.03.13 PH
per ECN #924

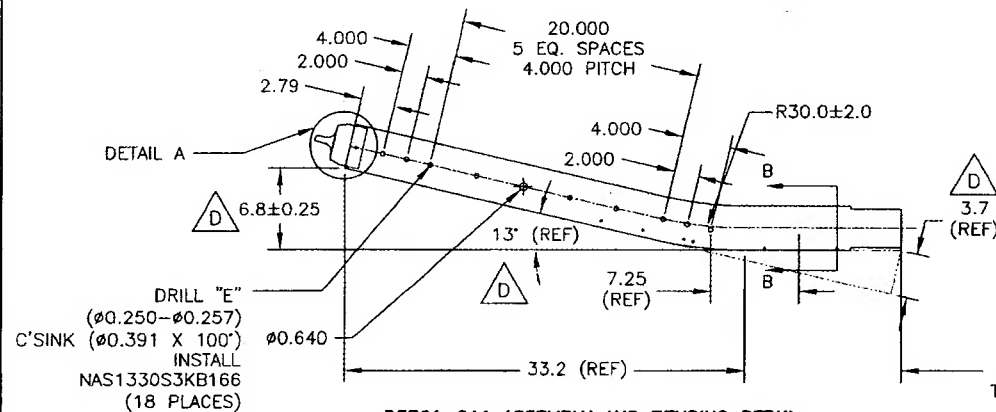






D3391-011 ASSEMBLY AND BENDING DETAIL

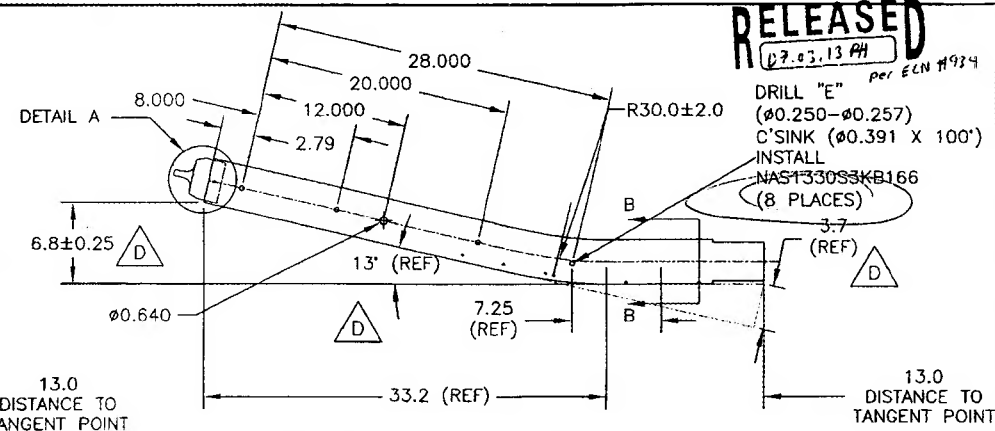

D3391-021 ASSEMBLY AND BENDING DETAIL


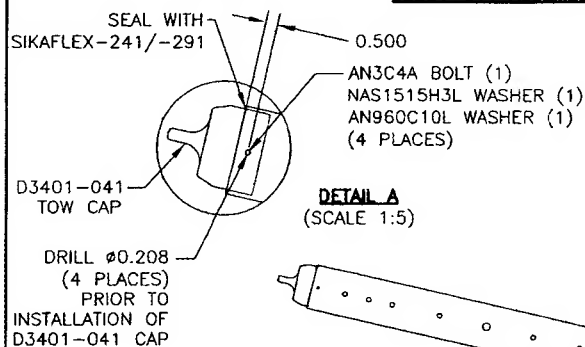


DETAIL A
(SCALE 1:5)

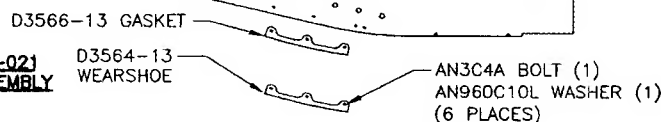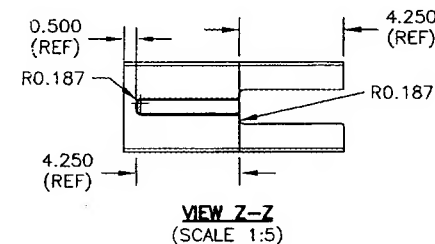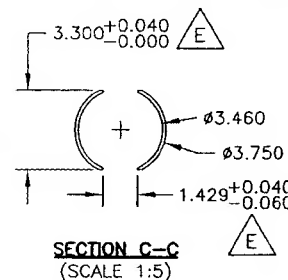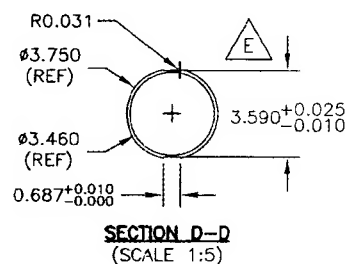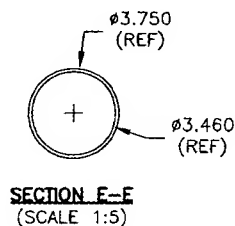










D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X	X	D3391-011	FWD TUBE ASSEMBLY
		D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
1	1	D3564-13	WEARSHOE
1	1	D3566-13	GASKET
10	10	AN3C4A	BOLT
4	4	NAS1515H3L	WASHER
10	10	AN960C10L	WASHER
30	20	NAS1330S3KB166	INSERT (OR NAS1330C3KB166)

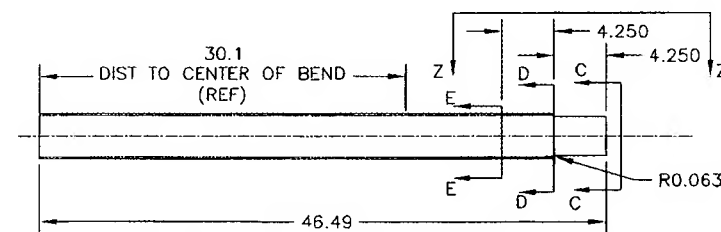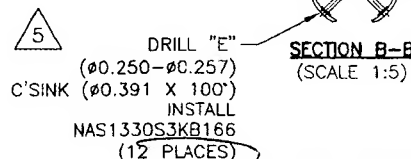

D3391-1 DRILLING AND CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.		DESIGN PH	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D3391		REV. F SHEET 2 OF 5	
DATE 07.01.18		TITLE 412 FLOAT SKIDTUBE		SCALE 1:10	

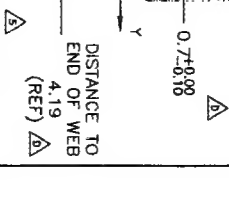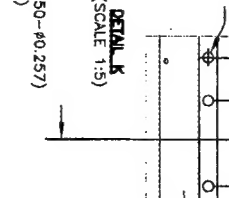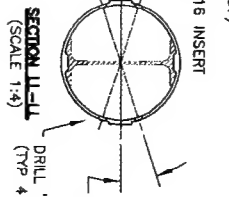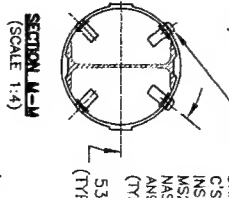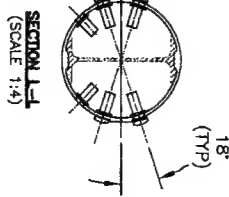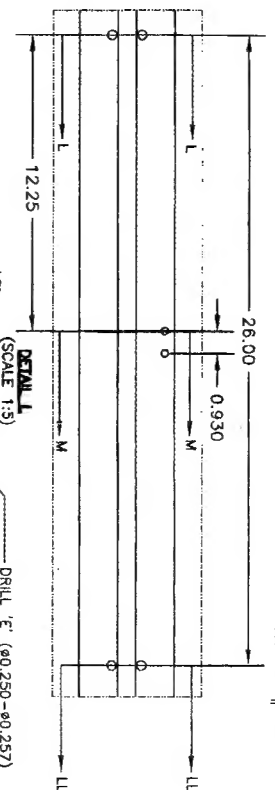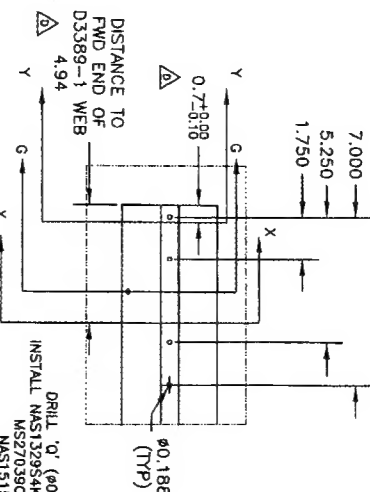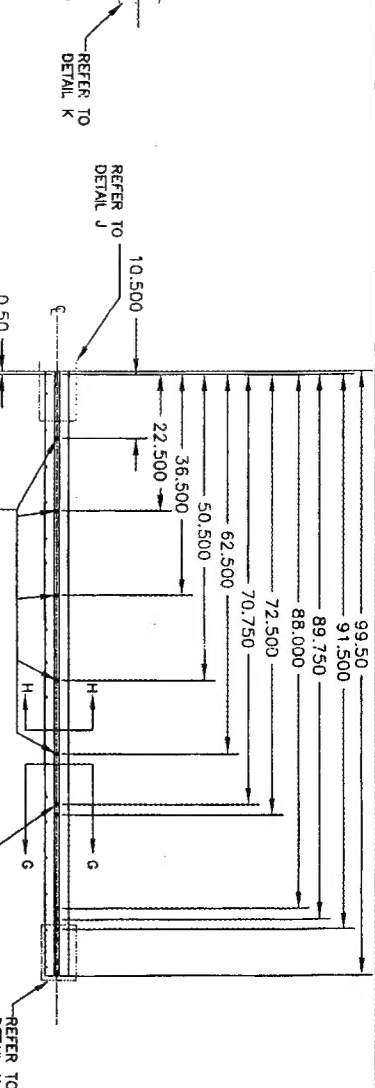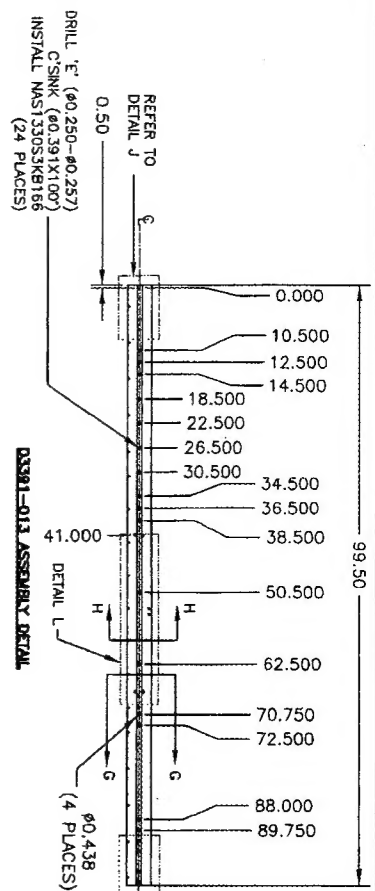

QTY -	QTY -	PART NUMBER	DESCRIPTION
013	023		
X	X	D3391-013	MID TUBE ASSEMBLY
X	X	D3391-023	MID TUBE ASSEMBLY
1	1	D2500-1-100	EXTRUSION
1	1	D3389-1	WEB
24	20	NAS1330SKB116	INSERT (OR NAS1330SKB116)
24	10	NAS1330SKB166	INSERT (OR NAS1330SKB166)
4	4	NAS1329SKB140	INSERT (OR NAS1329SKB140)
4	4	NAS1515H4L	WASHER
4	4	AN960C10L	WASHER
4	4	NAS1515H4L	WASHER
4	4	AN960C41BL	WASHER
4	4	MS27039C1-09	SCREW
4	4	MS27039C4-08	SCREW


- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKATLX-241/-291 PER OSI 015

SECTION X-X
(SCALE 1:2)



COPYRIGHT © 2006 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	DRAWN BY	DATE	TITLE
PH	PH	07/01/18	412 FLOAT SKIDTUBE
CHECKED	APPROVED	DRAWING NO.	REV. F
PH	PH	D3391	SHEET 3 OF 5
			SCALE
			1:20

RELEASED
07-03-13
PER 144 P934

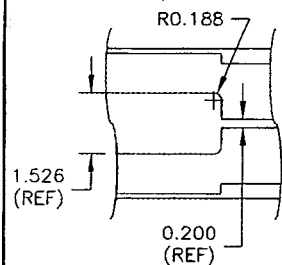


VIEW BB-BB
(SCALE 1:3)

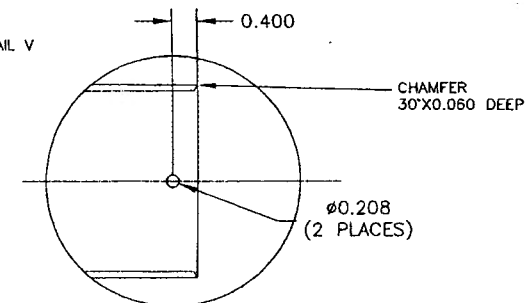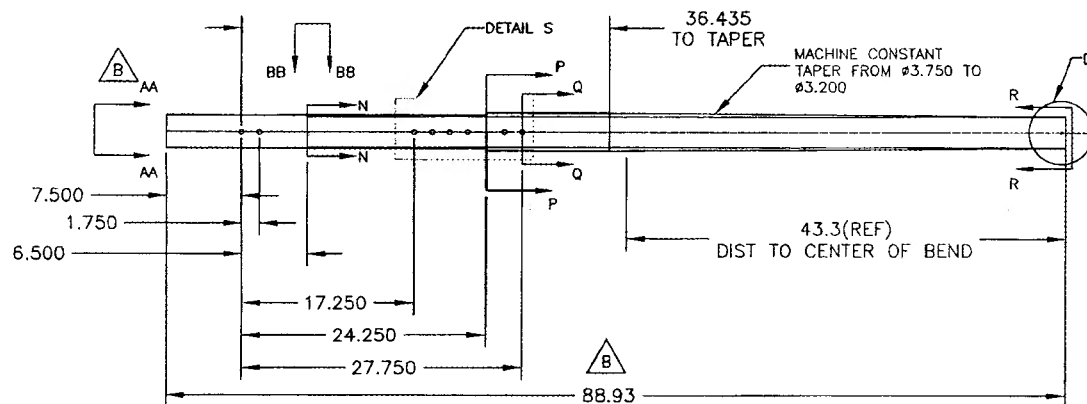


DETAIL V
(SCALE 1:2)


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

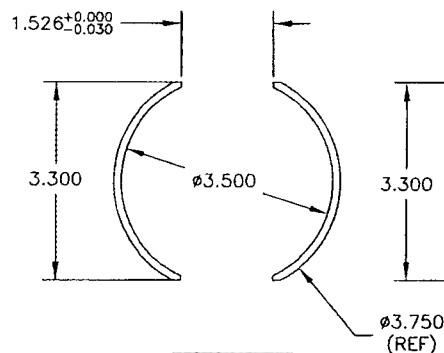


SECTION AA-AA
(SCALE 1:2)

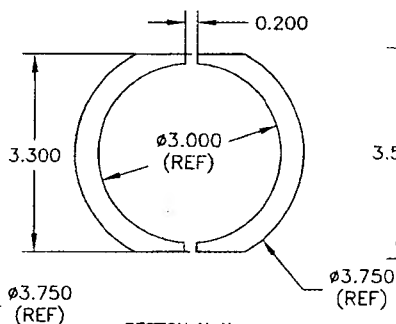


SECTION N-N
(SCALE 1:2)

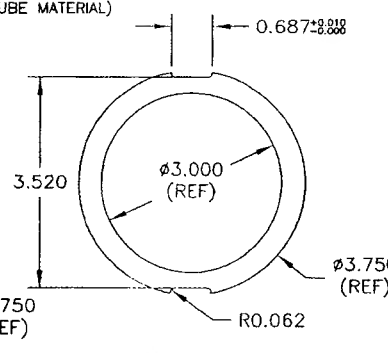


SECTION P-P
(SCALE 1:2)

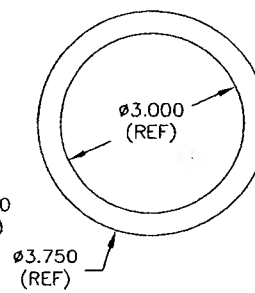


SECTION Q-Q
(SCALE 1:2)

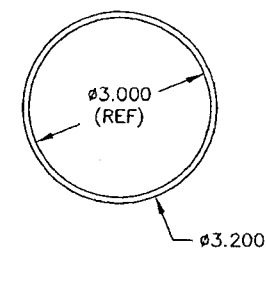

SECTION R-R
(SCALE 1:2)

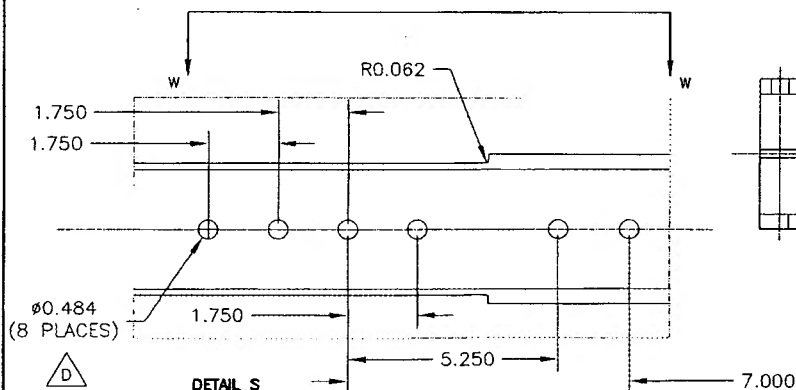

DETAIL S
(SCALE 1:3)

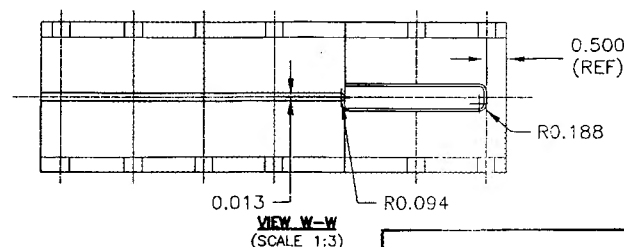


VIEW W-W
(SCALE 1:3)

RELEASED
07.03.13 PH
per ELN #934


COPYRIGHT © 2006 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DESIGN PH	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	REV. F
CHECKED #	APPROVED #	DRAWING NO. D3391	SHEET 4 OF 5
DATE 07.01.18	TITLE 412 FLOAT SKIDTUBE	SCALE 1:12	

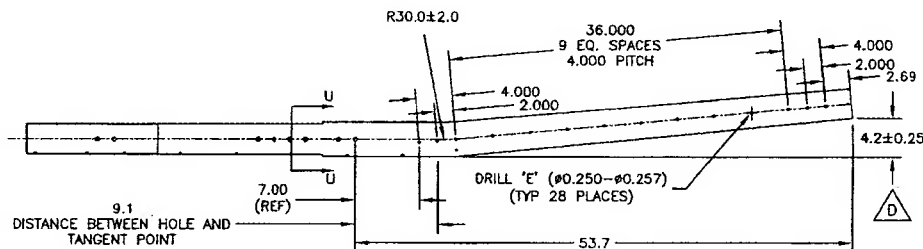


D3391-015 BENDING AND ASSEMBLY DETAIL

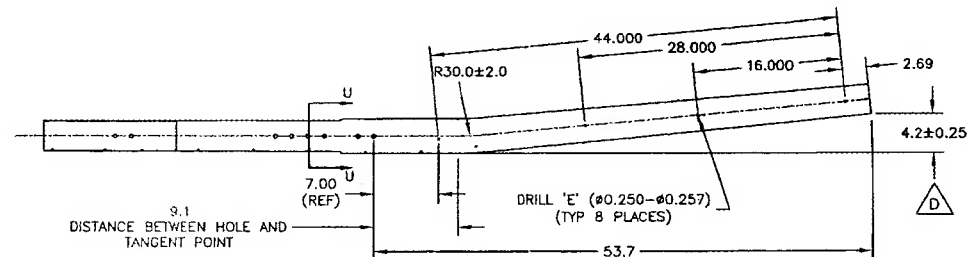

D3391-025 BENDING AND ASSEMBLY DETAIL

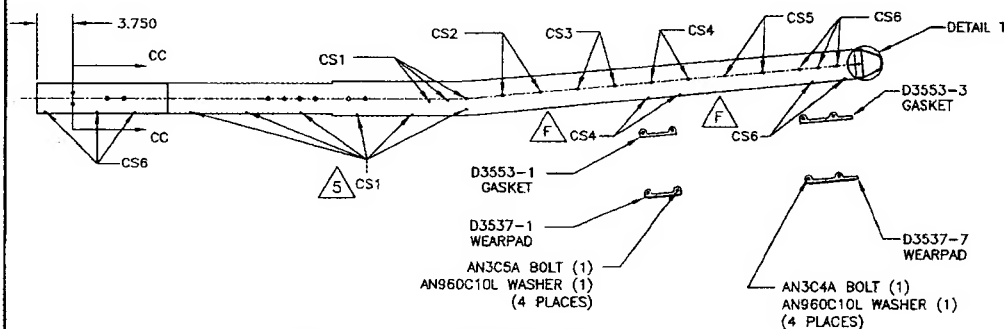


D3391-015 INSERT AND WEARPAD INSTALLATION DETAIL
(SEE TABLE)

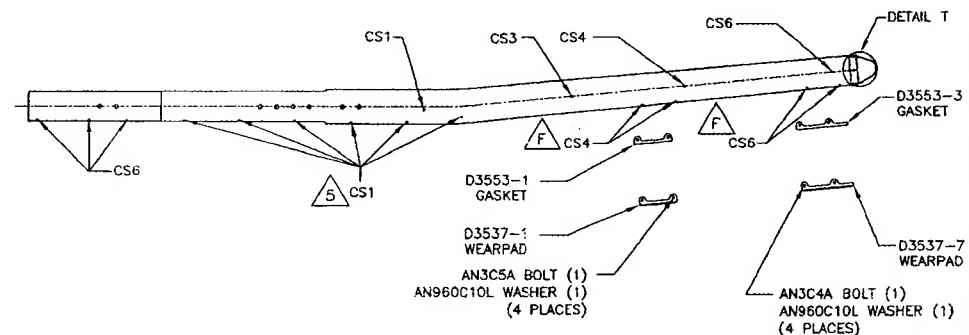

D3391-025 INSERT AND WEARPAD INSTALLATION DETAIL
(SEE TABLE)


D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
18	14	NAS1330S3KB366	INSERT (OR AES10KB366)
4	2	NAS1330S3KB316	INSERT (OR NAS1330C3KB316)
8	6	NAS1330S3KB266	INSERT (OR NAS1330C3KB266)
4		NAS1330S3KB216	INSERT (OR NAS1330C3KB216)
16	12	NAS1330S3KB166	INSERT (OR NAS1330C3KB166)
4		NAS1330S4KB151	INSERT (OR NAS1330C4KB151)
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
2	2	NAS1515H3L	WASHER
10	10	AN960C10L	WASHER

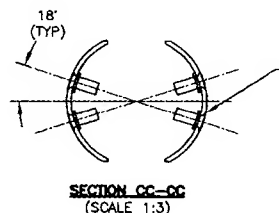


SECTION CC-CC
(SCALE 1:3)

DRILL 'Q' (#0.332-#0.338)
C'SINK (#0.529X100)
NAS1330S4KB151 INSERT (1)
(4 PLACES)

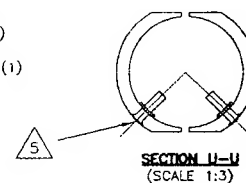

SECTION UU-U
(SCALE 1:3)

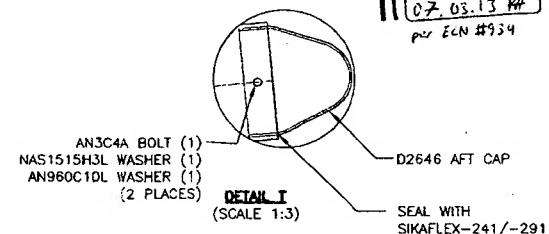

C'SINK AND INSTALL NAS1330S3KBXXX IN HOLES MARKED CS1-CS6 AS FOLLOWS

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'SINK	P/N
CS1	18	14	Ø0.425	NAS1330S3KB366
CS2	4		Ø0.391	NAS1330S3KB366
CS3	4	2	Ø0.391	NAS1330S3KB316
CS4	8	6	Ø0.391	NAS1330S3KB266
CS5	4		Ø0.391	NAS1330S3KB216
CS6	16	12	Ø0.391	NAS1330S3KB166

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC.	REV. F
CHECKED	APPROVED	DRAWING NO. D3391	SHEET 5 OF 5
DATE	TITLE	412 FLOAT SKIDTUBE	SCALE
07.01.18			1:12


RELEASED
07.03.13 RH
per ECN #934

31-308

FIRST ARTICLE INSPECTION CHECKLIST

X

1

Audited by:	
Date:	07/04/02

Rev	Date	Change	Revised by	Approved
A	06.04.27	New Issue P/O D3391-011/-021	KJ/JLM	
B	06.06.19	Tolerances revised per D3391 Rev. E	KJ/JLM	